

XR100 and XR500 Series

May 2007

Version 119 Software Update

Effective June 2007, all XR100 and XR500 Series Command Processor panels are being manufactured with version 119 (5/4/07) software. This version is an update from the version 118 (4/6/07) software previously available and contains updated operation.

Updated Operation

4 Hour Resound

Previously, any 1100 Series Wireless trouble (tamper) or low battery displayed in the keypad display would cause a resound of the keypad trouble buzzer at four hour intervals for All/Perimeter or Area Systems.

Panel operation is now improved and limits a resound of the trouble buzzer to only Wireless Holdup and Residential Fire UL Listed applications.

- When using an 1142 Wireless 2-Button Holdup Transmitter in an Area System, a wireless trouble (tamper) or low battery displayed in the keypad will cause a resound of the keypad trouble buzzer at four hour intervals.
- When using an 1161 or 1162 Wireless Smoke Detector programmed as a Fire or Fire Verify Zone type in an Area System, a smoke detector low battery displayed in the keypad will cause a resound of the keypad trouble buzzer at four hour intervals.
- When using an 1161 or 1162 Wireless Smoke Detector programmed as a Fire or Fire Verify Zone type in an All/Perimeter or Home/Sleep/Away system, a smoke detector low battery displayed in the keypad will cause a resound of the keypad trouble buzzer at four hour intervals except during the sleeping hours of 11:00 PM to 7:00 AM.

2ND Line Backup Dialer

When communication type is programmed NET and 2ND Line is DD the panel now sends Warning: Panel Backup Communication Fail (S12) and Backup Communication Line Restored (S04) messages to the receiver over the network when the panel fails to make 10 attempts over the backup 2ND Line dialer.

Previously, the panel sent Telephone Line 1 Trouble (S28) and Telephone Line 1 Restore (S29) messages over the network after 10 dial attempts.

Obtaining the New Software

XR100 and XR500 Series software update Version 119 (5/4/07) is available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.