

1100R Wireless Repeater August 2010

Version 200 Update

Effective August 2010, all 1100R Wireless Repeaters are being manufactured with Version 200 (7/15/10) software.

Updated Operation

XT30/XT50 Wireless Zones

When using the 1100R repeater with the XT30 or XT50 panel, or other panels using the 1100D Receiver, and using 1140 Series key fobs programmed as zones 31-34 or 41-44, other wireless zones programmed at higher zone numbers than the key fobs would not operate through the 1100R repeater.

All wireless zones programmed at lower zone numbers than key fobs operated correctly through the 1100R repeater. If you have existing sites using a repeater with this issue, zones 31-34 and 41-44 can be reprogrammed to place all key fobs at the highest zone numbers.

Ordering the New Software

To update the software in an existing 1100R Wireless Repeater, return the repeater to DMP and simply indicate "Update to Version 200" on the 6-digit RMA tag. This update will be done automatically as a standard part of the repair. If you need RMA tags, contact DMP Customer Service at 1-800-641-4282.

