

## XT30/XT50/XTL Series

August 2011

### Version 108 Software Update

The XTL/XT30/XT50 Version 108 (8/01/11) software is now available for download on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

Effective August 15<sup>th</sup>, 2011 all XT30/XT50/XTL Series panels are being manufactured and shipped with Version 108 (8/01/11) software.

### Updated Operation

#### Entry Delay

XT30/XT50 and XTL panels now provide an entry delay after being armed remotely.

Previously, when armed INSTANT and then disarmed from a keypad, a subsequent remote arming would automatically be set to INSTANT by the panel and an entry delay would not occur when the Exit zone was tripped at entry.

#### Zone Swinger Bypass

The zone swinger bypass issue described below and fixed in Version 108 (8/01/11) could only occur in panels when all three of the following were true:

1. The panel was using software version 107 (3/17/11) or higher. *Older versions are not affected.*
2. The Swinger Bypass Trips option of System Options was changed from the factory default of 2 trips and set to 0 trips. *The only reason to change Swinger Bypass Trips to 0 is in an attempt to completely turn off the zone swinger bypass operation.*
3. A zone must be programming for Swinger Bypass YES in Zone Information. *Zones that are armed and disarmed are default YES. All 24 hour zones are default NO.*

#### Software Issue

When the Swinger Bypass Trips option of System Options was set to 0, a zone with Swinger Bypass set to YES, would become swinger bypassed on the first trip of alarm or trouble. The keypad would not indicate alarm or trouble and only a zone swinger bypassed message would be sent to the Central Station receiver, if programmed in System Reports.

DMP recommends that a panel with Version 107 (3/17/11) software be updated if it is intended to operate with swinger bypass completely turned off by setting the number of trips to 0. If this option is set 1 to 6, then an update is not needed.

An alternative to an update where it is desired to completely turn off the swinger bypass operation is to leave the Swinger Bypass Trips option set to 2 and program all zones in Zone Information for Swinger Bypass NO.

### Obtaining the New Software

XTL/XT30/XT50 Series software updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.