

## SCS-104 Receiver Line Card

June 2012

### Version 101 Software Update

Version 101 (5/24/12) software is now available for download on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

Effective June 4, 2012, all SCS-104 Receiver Line Cards are being manufactured with Version 101 (5/24/12) software. This version contains the following updated operation.

### Updated Operation

#### Network Communication

On occasion, the SCS-104 line card could take longer than necessary to time out and close a failed network TCP communication session with a panel. This was only observed when a panel was connected to a local network experiencing communication troubles. If the panel retried multiple times to transmit a message, the SCS-104 could have experienced a temporary reduction in the number of available TCP sessions for network communication. If this condition occurred on a line card supporting panels with a Supervision Fail Time of less than 6 minutes, System Message 72 (WARNING: Network/Communication Path Trouble) could display for multiple accounts.

SCS-104 Line Cards with Version 101 (5/24/12) software now appropriately close failed TCP sessions.

This issue did not occur for panels using cellular or digital dialer communication.

### Obtaining the New Software

SCS-104 software updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

As of June 4, 2012, inventory for the SCS-104 will be completely updated to Version 101 (5/24/12) software.

The SCS-104 can now be updated using Remote Link Version 1.61 and a Model 399 Programming Cable. See the SCS-104 Installation Sheet (LT-1204) for more information.