

## Remote Link and System Link January 2013

### Version 1.66 Software Update


All Remote Link and System Link software will begin manufacture as Version 1.66 (1/2/13) effective January 17, 2013. This version is an update from the Version 1.66 (10/3/2012) previously shipped and contains updated operation. If your current Remote Link or System Link software is previous to Version 1.46, update to Version 1.59 before updating to 1.66 (1/2/13).

**Important Information:** Previously, SecureCom Wireless servers provided remote programming of panels through a cellular connection. These servers have been upgraded as of November 3, 2012. As a result of these upgrades, versions of Remote Link prior to version 1.59 (6/24/11) no longer have the ability to remote program through a panel's cellular connection. A Remote Link update is required if your company uses an older version of Remote Link. There is no requirement to update for remote programming if using Remote Link Version 1.59 (6/24/11) or higher.

### Feature

#### Weather Zip Code

A new option has been added to System Options programming of XT30/XT50 Series and XTL panels using Version 114 software with cellular or network communication to retrieve local weather data. The Weather Update option can be seen in the figure to the right. When connected to the panel, the 7800 Series Graphic Keypad displays the weather data in the form of icons on the main screen. This feature is also available with the DMP 7000 and 7100 Series Keypads. The weather data is displayed as part of the status list.

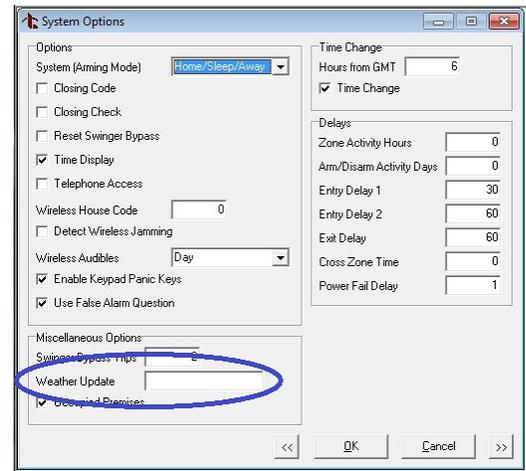

### Updated Operation

#### Account Groups User Code Change

When sending a User Code change to an Account Group of more than 100 panels, Remote Link could have experienced communication issues approximately midway through the process and failed to complete the batch update. The panels that did not properly receive the update would display in the Group Send status window as failed.

#### Account Groups Status Window

A panel assigned to more than one Account Group would not always display in the Group Send status window. This only occurred if the panel had previously been updated as part of a different group.

#### Account Number

When creating a new panel account using the Copy function, if the account number of the panel being copied was less than five digits in length, Remote Link would incorrectly use the copied panel's account number for Communication programming instead of the new account number. The account number in Communication programming would have to be manually changed.

#### View Only Operator

System Link now properly restricts operator access to View Only status when Operator Configuration is set to View Only. Previously, with View Only status enabled, the operator had complete access to make changes to panel accounts.

#### Remote Update Disconnect

Remote Link now automatically disconnects from the XR100/XR500 Series panel immediately after performing a remote software update. This allows the panel to reset and begin using the new version of software. Previously, if Remote Link was not disconnected by the operator after completing the remote update and programming changes were made, the panel would not always recognize the programming changes. This could display as invalid characters for entries such as a Profile Name being replaced with a numeric string.

### Obtaining the New Software

Remote Link and System Link Version 1.66 (1/2/13) updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

