

XR150/XR550 Series

September 2017

Version 171 Firmware Update

Version 171 (8/31/17) firmware is now available for download on the DMP Dealer Direct Website at http://dmp.com/dealer_direct.

Effective October 2, 2017, all XR150/XR550 Series panels will be manufactured with updated Version 171 (8/31/17) firmware. Updated units will begin shipping as current inventory is depleted.

Relock on Zone 2 Improvement

Starting with Version 171 (8/31/17), if the programmed strike time is longer than seven seconds, the following program settings must be met in panel programming in order for the Relock feature to work properly:

- Programming 734 Options must be programmed as YES in Device Setup
- Zone 2 must be programmed as a door contact
- Relock on Zone 2 change must be programmed as YES
- Zone 2 Bypass must be programmed as NO

If these programmed settings are met, the panel will lock the door when the door closes even when the strike time is longer than seven seconds.

If your 734 strike time is programmed as seven seconds or less and you have Relock on Zone 2 set to YES, you do not have to adjust the programming on the 734 or the panel.

Battery Charger Test

Prior to Version 171 (08/31/17), when AC power was restored to a panel after being on battery power, the panel immediately initiated a battery charger test, giving a false Battery Trouble message seconds later.

With the Version 171 (8/31/17) update, the battery charger test will delay for five minutes upon AC restoration. This gives the panel enough time to restore power before the battery charger test is conducted.

Obtaining the New Firmware

Firmware updates are available for download, free of charge, on the DMP Dealer Direct Website at http://dmp.com/dealer_direct.