REPAIR AU

88211

CellComSL Series Alarm Communicators January 2016

Hardware Update

As of January 26, 2016 all CellComSL Series Universal Alarm Communicators are being manufactured and shipped with updated Level C Hardware.

Zone 3 Operation

The following issue only occurred with CellComSLC Series Communicators manufactured with PC-0163 Level B hardware. This issue does not occur on the previous CellcomSLC Series manufactured on PC-0159. See Technical Update TU-0829 released December 21, 2015.

When using Zone 3 as a zone input connection, the CellComSL with Level B hardware would always report the zone as open. This would occur even though the end of line resistor was in a normal condition.

This issue does not affect CellComSL Communicators that are installed in the following applications:

- CID Dialer Connection
- Zones 1, 2 and 4 Input Connection
- Zone 4 Bell Connection
- Ademco/Honeywell ECP Connection



Receiving New Hardware

To update a Level B CellComSLC to Level C hardware, return the CellComSLC to DMP and simply indicate "Update to Latest Revision" on the RMA tag. This update will be provided at no charge. If you need RMA tags, contact DMP Customer Service at 1-800-641-4282.

