

XR150/XR350/XR550 Series Control Panels

June 2014

Version 105 Software Update

The XR150/XR350/XR550 Version 105 (6/24/14) software is now available for download on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

Effective June 30, 2014, all XR150/XR350/XR550 Series panels will be manufactured with updated 105 (6/24/14) software. As of August 22, 2014, inventory for the XR150/XR350/XR550 panels will be completely updated to Version 105 (6/24/14) software.

Updated Operation

Invalid Card Display

Previously for All/Perimeter or Home/Sleep/Away systems operating with Version 105 software, when a valid user code was entered at a keypad during a burglary alarm and the panel's bell output was sounding, INVALID CARD was incorrectly displayed and the system was not disarmed.

The user was able to disarm the system after the bell output was silenced using Alarm Silence in the User Menu or the Bell Cutoff occurred.

This issue did not occur in Area systems or with Version 104 and earlier software.

Canadian Dual EOL

For XR150/XR350/XR550 Canadian panels with Dual EOL enabled in System Options, zones one to eight could have incorrectly reported alarm/trouble/restore conditions repeatedly to the Central Station.

Graphic Keypad Display

XR150/XR350/XR550 Version 105 (6/24/14) corrects two exit delay countdown timing issues for the 7800 Series Graphic Keypad.

Previously for All/Perimeter or Home/Sleep/Away systems, the Interactive Shield icon of the Home Screen could not be used to arm the system after the following steps occurred:

1. The system had been armed starting the exit delay countdown.
2. An exit type zone was tripped just as the exit delay countdown ended.
3. The entry delay started before the keypad could return to the Home Screen.
4. A user code was entered to disarm.

This issue did not occur on Area systems.

Proper operation was restored to the Interactive Shield icon after the system was armed using the Carousel Menu Keypad icon or the system was armed from another keypad.

Also for All/Perimeter or Home/Sleep/Away systems, the Zone Monitor Alert window could have not cleared from the display after the following steps occurred:

1. The system was armed.
2. An exit type zone was tripped starting the Entry Delay and displaying ENTER CODE: - on the keypad.
3. A user code was entered to disarm.
4. Before ALL SYSTEM OFF was displayed, a zone with Zone Monitor enabled was tripped causing the Zone Monitor Alert to display.

This issue did not occur on Area systems.

Proper operation was restored after a keypad power cycle.

Obtaining the New Software

XR150/XR350/XR550 Series software updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

