# TECHNICAL UPDATE

# XR150/XR350/XR550 Series

## July 2013

## Version 101 Software Update

The XR150/XR350/XR550 Version 101 (7/16/13) software is now available for download on the DMP Dealer Direct Website at <u>http://dmp.com/dealer</u>.

Effective August 12, 2013, all XR150/XR350/XR550 Series panels will be manufactured with updated 101 (7/16/13) software. As of September 27, 2013, inventory for the XR150/XR350/XR550 panels will be completely updated to 101 (7/16/13) software.

#### **Features**

#### 7800 Z-Wave Menu Support

The new graphical Z-Wave menus of the 7800 Series Graphic Keypad Version 101 (6/28/13) are now supported by the XR150/XR350/XR550 Version 101 (7/16/13) software. For more information regarding this feature, refer to the 7800 Series Graphic Keypad Version 101 (6/28/13) Technical Update (TU-0683).

#### **Test Z-Wave Option**

A Z-Wave test option has been added as the last option in the Diagnostics (2313) menu to test communication between the panel and a Z-Wave device.



HALLWAY LIGHT	
LIGHT 02	0/0



This feature allows the installer to test panel communication with Z-Wave devices. A successful test indicates a response from a device. Press any top row Select key to view the Z-Wave Device List.

Press COMMAND to advance through each Z-Wave device and press any top row Select key to begin the test on the device displayed.

The name of the device displays above the device number. The current number of successful communications followed by the total number of attempts displays to the right of the device number. The test stops after 99 attempts.

Press COMMAND to view the final number of successful communications.

## **Updated Operation**

#### **MyAccess Panic Zone Status**

When a using a MyAccess text message to request panel status, the panel incorrectly responded to the user that a restored wireless panic zone was still in alarm. This would occur after a wireless panic zone was in alarm and then restored to normal condition by a Sensor Reset. This issue only affected MyAccess status messages. Communication of messages to the Central Station was not affected.

#### **Two Man Rule**

When disarming an area programmed for Two Man Rule, the panel may have disarmed the area without requiring a second code to be entered. This occurred if a user entered their code at another keypad/reader before the second code was entered for the area programmed for Two Man Rule.

#### **Z-Wave Dimmer Modules**

Previous versions of XR150/XR350/XR550 software activated a Z-Wave dimmer module's ability to allow manual control of the light's on/off switch. Jasco model 45602 dimmer modules version 3.0D were incompatible with this feature which caused the module to automatically turn back on when turned off by the panel. To maintain compatibility with Jasco version 3.0D dimmer modules, Version 101 (7/16/13) software does not activate any module's ability to allow manual control of the light's on/off switch.

### **Obtaining the New Software**

XR150/XR350/XR550 Series software updates are available for download free of charge on the DMP Dealer Direct Website at <a href="http://dmp.com/dealer">http://dmp.com/dealer</a>.

