

## TECHNICAL UPDATE

### Version 183 (3/6/19) Update

Updated Version 183 (3/6/19) firmware is now available on [DMPDealerAdmin.com](https://DMPDealerAdmin.com) or for download at [DMP.com/Dealer\\_Direct](https://DMP.com/Dealer_Direct).

### Features

#### Cell Status Test Improvement

Updated Version 183 (3/6/19) has improved the cellular status test in the Diagnostics menu. Previously when performing the cellular status test, if the 263 cellular module took longer than 30 seconds to get registered and establish the data connection, it was possible for the keypad display to stop at "Please Wait", "Registered", or "APN Accepted", even though the modem was working correctly. This update ensures that the keypad display will progress to "No ACK Received", giving clear indication that the modem is working, but the test was not successful.

#### 263H Communication Improvement

On rare occasion, if a 263H cellular module lost cell signal while attempting to communicate it would not attempt to reestablish connection to the cell tower. Updated Version 183 (3/6/19) ensures that the 263H cellular module will actively attempt to reestablish connection to the cell tower in the event connection was lost.