TECHNICAL UPDATE

1103 Wireless Universal Transmitter

February 2014

Version 107 Software Update

Effective February 27, 2014, all 1103 Wireless Universal Transmitters will be manufactured and shipped with Version 107 (2/24/14) software.

Updated Operation

Disarm Disable

When programming the external contact NORMALLY CLOSED of an 1103 transmitter operating with the recently released Version 107 (1/21/14) software, the Disarm Disable feature would not send a zone open message to the wireless receiver when disarmed and the zone was open for 20 seconds.

Version 107 (1/21/14) software was only shipped in transmitters with a serial number range of:

• 1604518 through 1604877 from 1/30/14 to 2/21/14.

This issue does not affect transmitters that are:

- Programmed with DISARM DISABLE NO.
- Programmed with the external contact NORMALLY OPEN.
- Using only the internal contact.

Please see Technical Update TU-0719 for a complete description of Disarm Disable operation.

Obtaining the New Software

To update the software in an existing 1103 Wireless Universal Transmitter, return the transmitter to DMP and simply indicate "Update to Current Version" on the 6-digit Repair Authorization Tag. If you need Repair Authorization Tags, contact DMP Customer Service at 1-800-641-4282.



