
Remote Link and System Link

May 2010

Version 1.54 Software Update

Effective May 2010, Remote Link and System Link are being manufactured as Version 1.54 (5/14/10) software. This version is an update from the Version 1.53 (3/22/10) software previously shipped and contains new features and updated operations.

Features

The following features are to support the XTL Version 105 (5/4/10) software. See TU-0554 for additional information.

XTL SecureCom Plan Rates

New SecureCom plans have been added for the XTL panel:

<i>Using Model 380-400 SIM Card</i>	<i>SIM Card</i>	<i>Data Included</i>
XTL: Daily test with a flat rate.	Level 400	N/A

<i>Text Plans available:</i>	<i>SIM Card</i>	<i>Available Panels</i>
None: Messaging is not included	Level 400	XR100, XR500, XT30, XT50, XTL
In Touch Messaging: Unlimited text messages	Level 400	XTL

XTL Wireless Jamming Support

Remote Link now supports the wireless jamming detection option.

XTL Fire Verify Zone Type

Remote Link now supports the enabling of the Fire Verify zone type for the XTL.

XTL Supervision Time

Remote Link now supports the Supervision Time option in Output Information to allow three (3) minute supervision time to be selected when using an 1135 Wireless Siren.

Remote Link now supports the Supervision Time option in Zone Information to allow a three (3) minute supervision time for Fire, Fire Verify and Supervisory zones.

XTL Panel Bell Trip

The default setting for the Trip With Panel Bell option in Output Information has been changed to YES.

XTL Cross Zone and Cross Zone Times

Remote Link now supports the Cross Zone option in Zone Information programming and the Cross Zone Time option in System Options programming.

Updated Operations

XT50 Wireless Zone

Remote Link now allows zone 81 to be used as a wireless zone when the first wireless zone is 80.

Previously, when programming the XT50 using Remote Link and the first wireless zone was 80, zone 81 would have the wireless option grayed out.

Printing Reports

Remote Link now correctly prints Zone Information programming for any panel.

Previously, printing reports for XR5, XR6 or XR10 panel Zone Information programming using Remote Link Version 1.53 caused an access violation requiring Remote Link to be restarted.

Output Information

Remote Link now operates properly when the Output Information programming option is chosen for panels that do not support the option.

Previously, the option would appear in the Remote Link Program drop down menu but when chosen caused an access violation. This issue only appears in Remote Link Version 1.53.

Obtaining the New Software

Remote Link and System Link updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

TU-0553 © 2010 Digital Monitoring Products, Inc.

	800-641-4282	INTRUSION • FIRE • ACCESS • NETWORKS
	www.dmp.com	2500 N. Partnership Boulevard
	Made in the USA	Springfield, Missouri 65803-8877