Remote Link and System Link
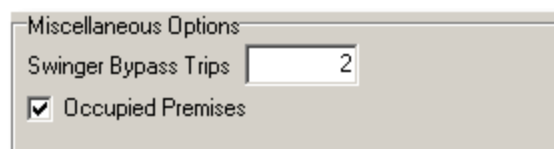## March 2011

Version 1.59 Software Update

Effective March 2011, all Remote Link and System Link software is being manufactured as Version 1.59 (3/14/11). This version is an update from the Version 1.58 (2/7/2011) previously shipped and contains updated operation.

Features

Swinger Bypass Trips

Remote Link Version 1.59 now supports the Swinger Bypass Trips option in XT30/XT50/XTL Version 107 panels that are to be released at a future date.

In System Options, enter the number of times (0-7) a zone can go into an alarm or trouble condition within one hour before being automatically bypassed. Bypassed zones are automatically reset whenever the area they are assigned to is disarmed. All 24-hour zones are reset when any area of the system is disarmed. Entering 0 (zero) disables this function. Default is 2.

Updated Operation

The following issues occur in the recently released Remote Link Version 1.58 (2/7/2011).

Displaying Holiday Dates

Remote Link Version 1.58 (2/7/2011) was unable to retrieve more than one holiday date. After retrieving panel programming and then choosing the Holiday Dates window, only a single holiday date would appear in the left column regardless of how many holiday dates had been programmed into the panel. Holiday Dates sent to the panel from Remote Link were not affected and transmitted successfully.

Profile Information

Remote Link Version 1.58 (2/7/2011) would display the incorrect information in the Profiles window. After creating a new panel, if the user opened the Profiles window, while connected to the panel, the Profile information would only show the Door Access and Anytime options as being enabled, regardless of the actual programming.

Obtaining the New Software

Remote Link Version 1.59 is available for download free of charge on the DMP Dealer Direct Website at http://dmp.com/dealer.

DMP
Digital Monitoring Products