# **Remote Link and System Link**

## August 2015

### Version 1.76 Software Update

Effective August 19, 2015, all Remote Link and System Link software is being manufactured as Version 1.76 (8/14/15). If your current Remote Link or System Link software is previous to Version 1.46, update to Version 1.59 before updating to 1.76 (8/14/15).

## **Updated Operation**

### Large Account Performance

For Remote Link Version 1.75 (7/8/15), when the Remote Link operator connected to a panel with a large number of programmed zones or users and made a programming change, the change was not immediately sent when selecting the Apply button. The programming change was only sent after the panel programming was retrieved. In Version 1.76 (8/14/15), changes are immediately sent to the panel when the Apply button is selected.

### **Dialer Disconnect**

For Remote Link Version 1.75 (7/8/15), when the Remote Link operator attempted to connect to a panel through an SCS-1R or SCS-105 using digital dialer and then tried to abort the connection, "Panel Connection Error" was displayed but the cancellation message was not sent to the receiver to hang up the dialer. The receiver would

stay connected to the panel's dialer line until the Remote Link operator chose Panel>Hangup to send the hang up command to the receiver.

### **Printing Zone Name**

When printing the programming for a panel (File>Print>Panel Programming), a zone name over 16 characters in length would be incorrectly cutoff as shown in Figure 1.

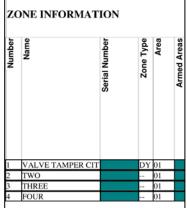



Figure 1: Panel Programming Report

#### **Inactive User Audit Days**

When Inactive User Audit Days is programmed and Panel Log events were requested from the panel, the User Number, User Name and "Inactive" status were not displayed as shown in Figure 2. Only the log entry time and date stamp of the Inactive User Code Audit event was displayed. In Version 1.76 (8/14/15), Panel Log entry time, date stamp, User Number, User Name and "Inactive" status is correctly displayed on the Panel Event Log report as shown in Figure 3.

1/24/2014	
1:20 AM	WARNING: Path 1 Net PrimaryTrouble
8:06 AM	Panel Restart
8:07 AM	Path 1 NetPrimaryRestored
8:31 AM	Remote Command Received
8:31 AM	Remote Programming Complete
8:36 AM	

Figure 2: Panel Event Log Missing Event Information





### **Obtaining the New Software**

Remote Link and System Link Version 1.76 (8/14/15) updates are available for download free of charge on the DMP Dealer Direct Website at <u>http://dmp.com/dealer</u>.



TU-0810 © 2015 Digital Monitoring Products, Inc.