

FEATURE UPDATE | JULY 2021

Version 212 (6/28/21) Update

Starting July 1, 2021, all X1 Series Door Controllers can update to Version 212 (6/28/21) firmware.

Features


Initialize Hardware at Door Controller

With Version 212 (6/28/21) the X1 can now be set to factory settings locally at the door controller without a required connection to Dealer Admin™.

To initialize the door controller, perform the following steps:

1. *X1-8 Only:* Unplug the XD door control module(s) from the 4-wire connector.
2. Place a jumper over the L header of the door controller.
3. Within 15 seconds, place a jumper on the center two pins of the 4-wire connector (short the green and yellow together). Reader 1, Reader 2, Fire, and Lockdown operation LEDs will turn on.
4. Within 15 seconds, remove both jumpers. The above LEDs will turn off. The Power LED will turn on steady to indicate the factory default is complete.
5. *X1-8 Only:* Plug the XD door control module(s) back into the 4-wire connector.

This process clears all Dealer Admin programming and defaults the system back to factory settings.

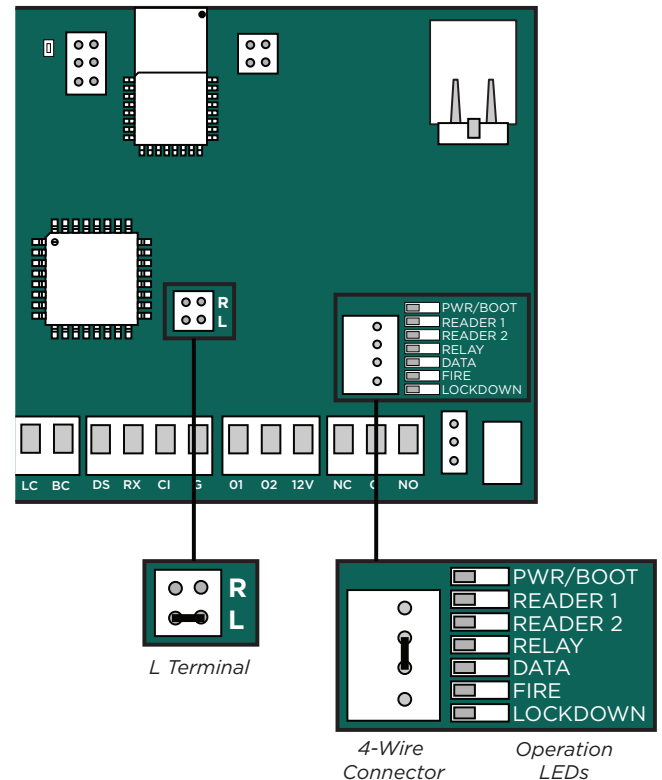

Improvements

Card + Pin and Dual Authority Default Change

To make programming the X1 easier, with Version 212 (6/28/21) you no longer need to program **Card + Pin** and **Dual Authority** in two different places. Now you only need to program them in Virtual Keypad's **Groups**.

Supporting Software

With this update, Dealer Admin automatically updates to Version 2.65.0.