

XR150/XR350/XR550 Series Control Panels

March 2015

Version 108 Firmware Update



XR150/XR350/XR550 Version 108 (3/9/15) firmware is now available for download on the DMP Dealer Direct Website at <http://dmp.com/dealer>.

Effective April 6, 2015, all XR150/XR350/XR550 Series panels will be manufactured with updated Version 108 (3/9/15) firmware. As of the May 18, 2015, inventory for the XR150/XR350/XR550 Series panels will be completely updated to Version 108 (3/9/15) firmware.

Features

Z-Wave Garage Doors

The XR150/XR350/XR550 Series Control Panels now support Z-Wave Garage Doors, such as the model Z-GD00Z-4. The Locks Screens of the 7800 Series Graphic Touchscreen Keypad, MyVirtualKeypad.com Browser and the Virtual keypad App have been renamed Doors and now display Z-Wave Garage Doors, Z-Wave Locks, and Door Devices.

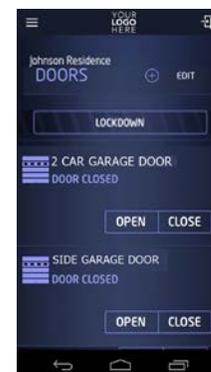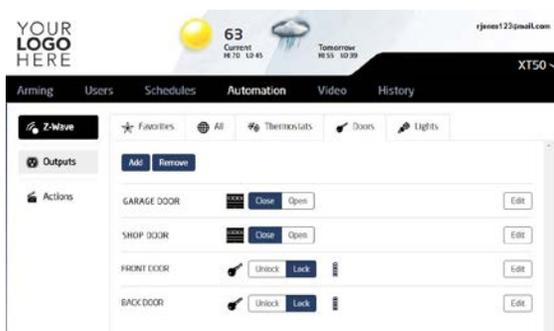

Z-Wave Optimize (OPT) User Menu

The Rediscover feature in Z-Wave Setup in the User Menu has been renamed to Optimize (OPT). When Optimize is selected, the panel sends a command to each Z-Wave device in the system to update its communication route back to the 738Z module. This feature can be used to re-establish communication with a Z-Wave device after it has been moved to a different location.

Updated Operation

Allow Own User Code Change

Previously when Allow Own User Code Change was programmed YES in System Options, users without Arm or Disarm enabled in their profile were unable to change their own code. When the user attempted to change their own user code, the keypad displayed NO AUTHORITY and became unresponsive. Keypad operation could only be restored by resetting the control panel using the J16 Reset header. Other keypads and control panel functions were not affected.

Obtaining the New firmware

XR150/XR350/XR550 Series firmware updates are available for download free of charge on the DMP Dealer Direct Website at <http://dmp.com/dealer>.